

Chiltern House Stocking Lane Hughenden Valley High Wycombe Buckinghamshire HP14 4ND UK

t +44 (0) 1494 569800 f +44 (0) 1494 564895 e cif⊕chilternfire.co.uk w www.chilternfire.co.uk

Our Ref: MTP/F02023

18th July 2002

Exitile Ltd FIRE PROOFING SERVICES
49-61 Jodrell Street ASTON ROAD
Nuneaton
Warwickshire
CV115E6 CV11 5EL

For the attention of Mr T Beasley MR R STOKES

Dear Sir

FIRE PROOFING SERVICES

Re: Report on an indicative test of 1No type of Exitile Ltd access panel for air leakage, following the principles of BS 5368: Part 1, 1976, methods of testing windows for air permeability. Contract Reference – MTP/F02023

This letter is to confirm the results of indicative testing performed on behalf of your company under the above reference on the 17th and 18th March 2002.

Specimen

F.P.S

The Exitile Ltd access panel was fitted with a removable key locking mechanism. The overall dimensions of the specimen were 1838mm high x 603mm wide x 65mm thick.

The access panel was fitted by the client within a timber sub frame, which was flush with both faces of the panel. WD-BF-2HR-AT

Description of Exitile access panel (ref. EX/WB/SB/SW/AT)

- 1.1 Overall nominal frame dimensions were 1838mm high x 603mm wide x 65mm thick. The panel was single acting and opened outwards
- 1.2 The frame consisted of a 1.2mm thick Zintec Steel section with 5No M6 bolts welded to the hinge side. The 25mm wide beaded front flange was mitred at each corner. Two Lorient Polyproducts Limited neoprene seals were fixed to the inside back edge of the frame, between the door tray and frame
- 1.3 The overall nominal dimensions of the panel door were 1830mm high x 595mm wide x 62mm thick. The access panel door tray consisted of a 1mm thick steel skin, which was polyester powder coated in RAL9010, 20% gloss, with preformed 1mm thick steel top hat stiffeners welded to the inner face. The voids within the door tray were filled with Rockwool cavity wall insulation. A 12.5mm thick sheet of Lafarge Megadeco wallboard was fixed to the rear face of the door tray with 20No drywall screws

- 1.4 A continuous steel hinge was welded to the door tray and fixed to the frame using M6 hank brushes and bolts welded to the frame at 150mm in from the edges and 300mm centres
- 1.5 The panel was locked with a 3 point locking system (manufactured by EMKA reference 1049-U20)
- 1.6 The panel was locked with a removable key. The key lock hole in the front of the door tray was fitted with a removable screw bung with a neoprene washer. 4No 16mm diameter holes were cut into the panel (2No in the top edge and 2No in the bottom edge). These holes were plugged with 16mm plastic insert plugs.

The client supplied the above description, and it was verified where possible by a Chiltern Dynamics Engineer.

The sample was marked Chilt/P02023 and fitted vertically in the test rig, and secured to ensure there was no movement or twist.

The access panel was then tested on both the internal and the external faces.

Results

Internal face	Pressure applied (pa)	1 st Recorded leakage m ³ /h	2 nd Recorded leakage m ³ /h
	15pa	0.07	0.05
	30pa	0.00	0.00
	45pa	0.16	0.17
	60pa	0.10	0.09
	75pa	0.11	0.11
	90pa	0.16	0.18
	105pa	0.14	0.15
	120pa	0.16	0.13
	135pa	0.11	0.11
	150pa	0.11	0.15
External face	Pressure applied (pa)	1 st Recorded leakage m ³ /h	2 nd Recorded leakage m³/h
	15pa	0.00	0.02
	30pa	0.00	0.24
	45pa	0.05	0.11
	60pa	0.11	0.16
	75pa	0.05	0.11
	90pa	0.11	0.17
	105pa	0.16	0.22
	120pa	0.16	0.22
	135pa	0.06	0.17
	150pa	0.16	0.27

These test results relate to an investigation which utilised the test methods given in BS 5368: Part 1, 1976, methods of testing windows for air permeability, the full requirements of the test were not, however, fully complied with.

The information is provided for the test sponsor's information only and should not be used to demonstrate performance against the standard nor compliance with a regulatory requirement

This test was not conducted under the requirements of UKAS accreditation.

Issued under the authority of

Jon Osborn Testing Manager

Date: 18. JULY. 2002

Report written by

Alan Turvey

Test Engineer / Project Leader

LSAL AHL OI PLEASE ATTACH OCICIMA

Tom Beasley

INCORPECT.

Leakage

Leakage

reakage

Air permeability test (air tightness) Alan Turvey [Aturvey@chiltemfire.co.uk] 'moo.elitike@mot' Subject: :01

> Sent: From:

,moT lasd

April), here are the results of each test performed. Following the testing performed on your specimen yesterday (17th

reakage I deer - (lenterni) 10 sos?

09 SP DE relative to opening joint - ma/hr/m length Pressure (pa) Chamber permeability Total permeability

BE.E OSI 90.0 SE.E 39.6 SEI 91.0 45.E 08.2 ISO ₽€. € 9T'0 58.5 SOI 11.0 92.2 08.5 0.6 90.0 2.26 66'I 51 II.0 84.I 95 · 1

91.0 ST'F

relative to opening joint - m3/hx/m length Chamber permeability Total permeability (Eq) enussers Eace Ol (internal) - test 2

1.72 09 II.O 81.1 95 81.I 1.0 0

71.0 SE.E 72.0 99.A 38.8 88.8 USE 35.8 SEL SS.0 88.€ 08.5 150 55.0 3.61 EE.S SOI 4I.0 80.€ 2.26 TT:O 58.5 66°I 91.0 GD.I

Chamber permeability skeazante (be) Esce OZ (External) - test I

50 SE.E DE.E 30 5.09 1.72 70.0 relative to opening joint - m3/hr/m length

50.0 69.9 01.0 p2.8 \$1.5 96.4 91.5

SET 91.0 92.6 54.8 120 PI'O 94.8 94.1 501 59.7 28.9 91.0 06

II.0 AE.01 08.6 11.0 08.6 92.6

Face OZ (internal) - test Z DSI

relative to opening joint - ma/hx/m length Chamber permeability Pressure (pd)

60.0 £5.8 69.5 LI.O 66.4 91.5 55 PE.E DE 80.0 66.I

SOI 71.0 14.7 58.9 06 IT'O 09.9 70.9

EI.O ISO 91.0 85.8 91.7

SI.0 98.0I 08.6 OSI tt.o 08.6 92.6 SEI 60.6 99.8

Total permeability

Total permeability

Test to 600pa
Face 02 (internal) - test 3
Pressure (pa) Chamber permeability Total permeability Leakage relative to opening joint - m³/hr/m length
50 4.16 4.69 0.11
100 6.85 7.12 005
150 9.80 9.53 -0.05
200 10.95 11.41 0.09
300 13.70 14.76 0.22
400 16.85 17.84 0.20
500 19.80 20.08 0.05
600 22.15 22.73 0.12

The maximum leakage at 75pa was recorded as 0.11 m 3 /hr/m length. With the $\pm 2\%$ error of our equipment (error allowable by UKAS) you could possibly have a leakage of 0 at 75 pa.


I will get a test confirmation to you tomorrow (I did promise today, unfortunately I was needed in the test lab)
If I can be of any further assistance, please do not hesitate to contact me.

Regards,

Alan Turvey Test Engineer / Project Leader

Tel: +44 (0) 1494 569 839 Fax: +44 (0) 1494 564 895

SECTION SHOWING ACCESS PANEL AIRTIGHT TEST ON 18/04/2002

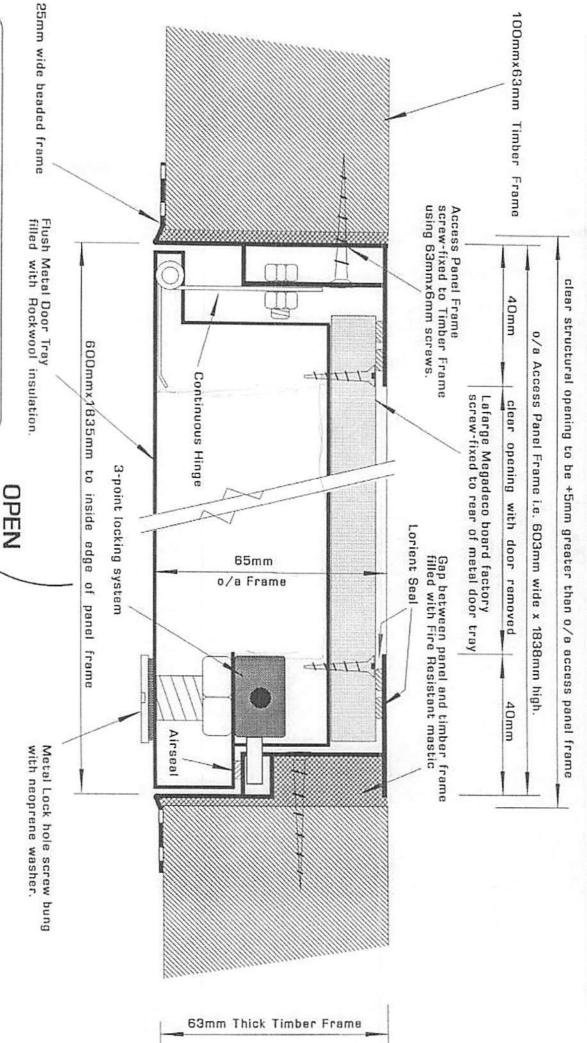

Airtight Panel -

2 Hour Fire Rated

TYPE

EX/WD/SB/SW/AT